


Sample Report — South Elevation

Created by Fasadogled · Date: 17 Aug 2026 · Defects: 3 · Photos: 3

This is a sample Fasadogled report, produced from an illustrative building rather than a real survey. Visual condition inspection of the south elevation, carried out by rope access. Three defects recorded; close-up photography by the access team on site.


Overview — Marked Defects

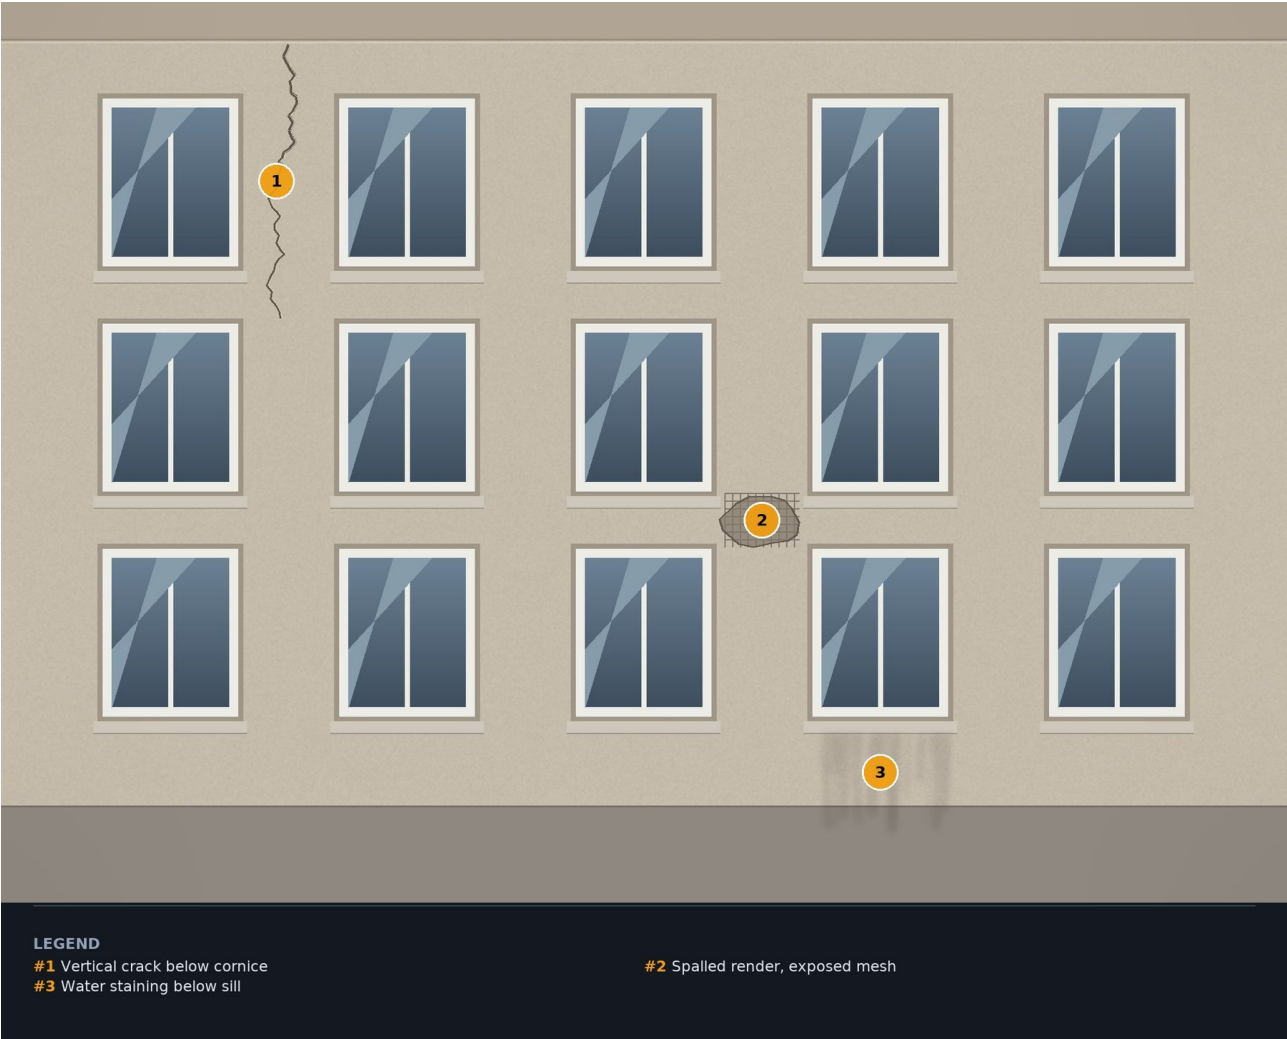

Defect Details

#1 Vertical crack below cornice


Crack approximately 1.4 m long running from the cornice joint, 2–4 mm wide, widening towards the top. Render sounds hollow either side. Water ingress likely.

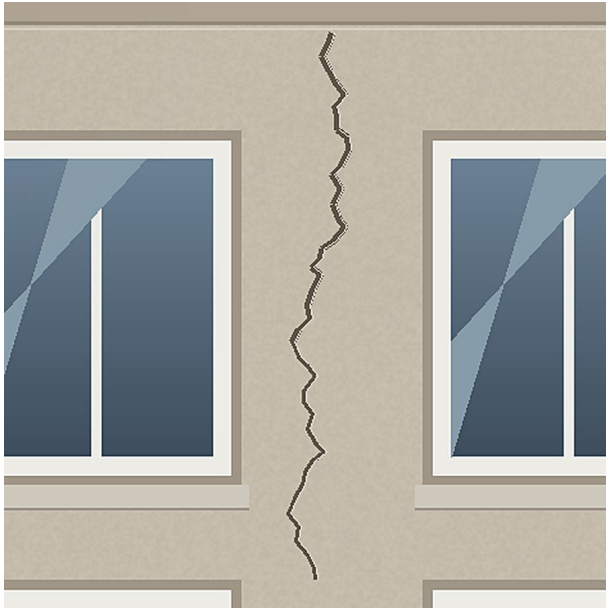

Marko P. · 17 Aug 2026

#2 Spalled render, exposed mesh


Render detached over roughly 0.35 m², reinforcement mesh exposed and beginning to corrode. Edges friable — remove back to sound material before patching.

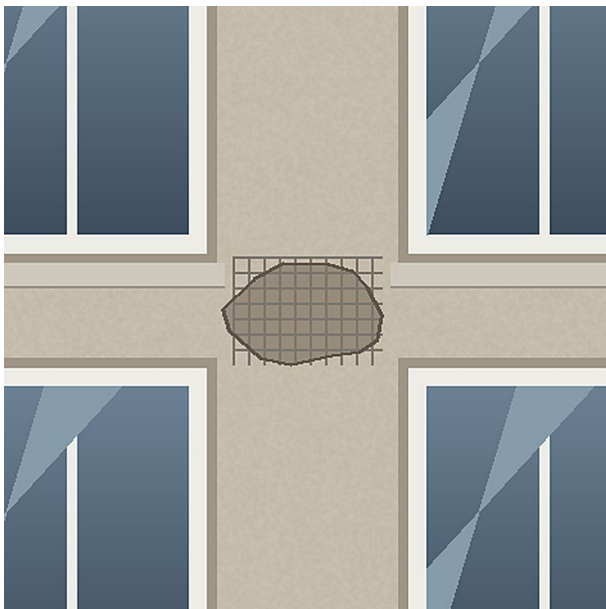

Ana K. · 17 Aug 2026

#3 Water staining below sill

Persistent staining over about 1.8 m of wall beneath a failed sill drip. Sealant perished along the full reveal; re-form the drip and reseal.

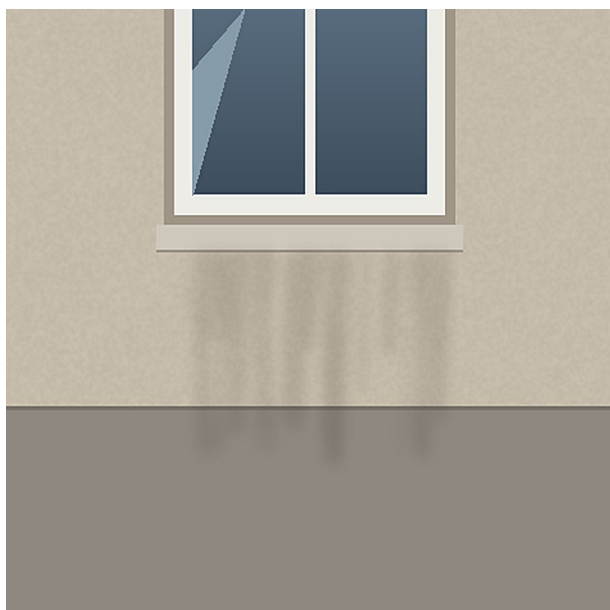

Marko P. · 17 Aug 2026